


Инструментальные пружины, сверхлёгкая нагрузка, желтый цвет


Стандарт JIS B 5012 Misumi SWF / SF / TF



D	d	L	Жесткость пружины Н/мм (кгс/мм)	F=Lx40%		F=Lx45%		F=Lx50%		Артикул Тип D-L
				Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	
Количество операций			1 000 000	500 000		300 000				
6	3	15	7,8 {0,80}	6,0	4,7 {4,8}	6,8	5,3 {5,4}	7,5	59 {6,0}	SW 6-15
		20	5,9 {0,60}	8,0	9,0	10,0	12,5	15,0	SW 6-20	
		25	4,7 {0,48}	10,0	11,3	13,5	15,0	17,5	SW 6-25	
		30	3,9 {0,40}	12,0	13,5	15,0	17,5	20,0	SW 6-30	
		35	3,4 {0,34}	14,0	15,8	17,5	20,0	22,5	SW 6-35	
8	4	40	2,9 {0,30}	16,0	18,0	20,0	22,5	25,0	79 {8,0}	SW 6-40
		10	15,7 {1,6}	4,0	4,5	5,0	5,0	5,0	71 {7,2}	SW 8-10
		15	10,5 {1,07}	6,0	6,8	7,5	7,5	7,5	79 {8,0}	SW 8-15
		20	7,8 {0,80}	8,0	9,0	10,0	10,0	10,0	79 {8,0}	SW 8-20
		25	6,3 {0,64}	10,0	11,2	12,5	12,5	12,5	79 {8,0}	SW 8-25
		30	5,2 {0,63}	12,0	13,5	15,0	15,0	15,0	79 {8,0}	SW 8-30
		35	4,5 {0,46}	14,0	15,7	17,5	17,5	17,5	79 {8,0}	SW 8-35
		40	3,9 {0,40}	16,0	18,0	20,0	20,0	20,0	79 {8,0}	SW 8-40
		45	3,5 {0,36}	18,0	20,2	22,5	22,5	22,5	79 {8,0}	SW 8-45
		50	3,1 {0,32}	20,0	22,5	25,0	25,0	25,0	79 {8,0}	SW 8-50
		55	2,9 {0,29}	22,0	24,7	27,5	27,5	27,5	79 {8,0}	SW 8-55
		60	2,6 {0,27}	24,0	27,0	30,0	30,0	30,0	79 {8,0}	SW 8-60
		65	2,4 {0,25}	26,0	29,3	32,5	32,5	32,5	79 {8,0}	SW 8-65
		70	2,2 {0,2}	28,0	31,5	35,0	35,0	35,0	79 {8,0}	SW 8-70
		75	2,1 {0,21}	30,0	33,8	37,5	37,5	37,5	79 {8,0}	SW 8-75
80	2,0 {0,20}	32,0	36,0	40,0	40,0	40,0	79 {8,0}	SW 8-80		
10	5	10	19,6 {2,00}	4,0	4,5	5,0	5,0	5,0	98 {10}	SW 10-10
		15	13,1 {1,33}	6,0	6,8	7,5	7,5	7,5	98 {10}	SW 10-15
		20	9,8 {1,00}	8,0	9,0	10,0	10,0	10,0	98 {10}	SW 10-20
		25	7,8 {0,80}	10,0	11,2	12,5	12,5	12,5	98 {10}	SW 10-25
		30	6,5 {0,67}	12,0	13,5	15,0	15,0	15,0	98 {10}	SW 10-30
		35	5,9 {0,57}	14,0	15,7	17,5	17,5	17,5	98 {10}	SW 10-35
		40	4,9 {0,50}	16,0	18,0	20,0	20,0	20,0	98 {10}	SW 10-40
		45	4,4 {0,44}	18,0	20,2	22,5	22,5	22,5	98 {10}	SW 10-45
		50	3,9 {0,40}	20,0	22,5	25,0	25,0	25,0	98 {10}	SW 10-50
		55	3,6 {0,36}	22,0	24,7	27,5	27,5	27,5	98 {10}	SW 10-55
		60	3,3 {0,33}	24,0	27,0	30,0	30,0	30,0	98 {10}	SW 10-60
		65	3,1 {0,31}	26,0	29,2	32,5	32,5	32,5	98 {10}	SW 10-65
		70	2,8 {0,29}	28,0	31,5	35,0	35,0	35,0	98 {10}	SW 10-70
		75	2,6 {0,27}	30,0	33,7	37,5	37,5	37,5	98 {10}	SW 10-75
		80	2,5 {0,25}	32,0	36,0	40,0	40,0	40,0	98 {10}	SW 10-80
90	2,2 {0,22}	36,0	40,5	45,0	45,0	45,0	98 {10}	SW 10-90		
12	6	15	18,3 {1,87}	6,0	6,8	7,5	7,5	7,5	137 {14}	SW 12-15
		20	13,7 {1,40}	8,0	9,0	10,0	10,0	10,0	137 {14}	SW 12-20
		25	11,0 {1,12}	10,0	11,2	12,5	12,5	12,5	137 {14}	SW 12-25
		30	9,2 {0,93}	12,0	13,5	15,0	15,0	15,0	137 {14}	SW 12-30
		35	7,8 {0,80}	14,0	15,7	17,5	17,5	17,5	137 {14}	SW 12-35
		40	6,9 {0,70}	16,0	18,0	20,0	20,0	20,0	137 {14}	SW 12-40
		45	6,1 {0,62}	18,0	20,2	22,5	22,5	22,5	137 {14}	SW 12-45
		50	5,5 {0,56}	20,0	22,5	25,0	25,0	25,0	137 {14}	SW 12-50
		55	5,0 {0,51}	22,0	24,7	27,5	27,5	27,5	137 {14}	SW 12-55
		60	4,6 {0,47}	24,0	27,0	30,0	30,0	30,0	137 {14}	SW 12-60
		65	4,2 {0,43}	26,0	29,2	32,5	32,5	32,5	137 {14}	SW 12-65
		70	3,9 {0,40}	28,0	31,5	35,0	35,0	35,0	137 {14}	SW 12-70
		75	3,7 {0,37}	30,0	33,7	37,5	37,5	37,5	137 {14}	SW 12-75
		80	3,4 {0,35}	32,0	36,0	40,0	40,0	40,0	137 {14}	SW 12-80
		90	3,1 {0,31}	36,0	40,5	45,0	45,0	45,0	137 {14}	SW 12-90
14	7	20	17,7 {1,80}	8,0	9,0	10,0	10,0	10,0	177 {18}	SW 14-20
		25	14,1 {1,44}	10,0	11,2	12,5	12,5	12,5	177 {18}	SW 14-25
		30	11,8 {1,2}	12,0	13,5	15,0	15,0	15,0	177 {18}	SW 14-30
		35	10,1 {1,03}	14,0	15,7	17,5	17,5	17,5	177 {18}	SW 14-35
		40	8,8 {0,90}	16,0	18,0	20,0	20,0	20,0	177 {18}	SW 14-40
		45	7,8 {0,80}	18,0	20,2	22,5	22,5	22,5	177 {18}	SW 14-45
		50	7,1 {0,72}	20,0	22,5	25,0	25,0	25,0	177 {18}	SW 14-50
		55	6,4 {0,65}	22,0	24,7	27,5	27,5	27,5	177 {18}	SW 14-55
		60	5,8 {0,60}	24,0	27,0	30,0	30,0	30,0	177 {18}	SW 14-60
		65	5,4 {0,55}	26,0	29,2	32,5	32,5	32,5	177 {18}	SW 14-65
		70	5,0 {0,51}	28,0	31,5	35,0	35,0	35,0	177 {18}	SW 14-70
		75	4,7 {0,48}	30,0	33,7	37,5	37,5	37,5	177 {18}	SW 14-75
		80	4,4 {0,45}	32,0	36,0	40,0	40,0	40,0	177 {18}	SW 14-80
		90	3,9 {0,40}	36,0	40,5	45,0	45,0	45,0	177 {18}	SW 14-90
		100	3,5 {0,36}	40,0	45,0	50,0	50,0	50,0	177 {18}	SW 14-100

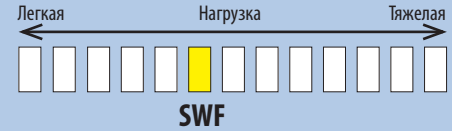

D	d	L	Жесткость пружины Н/мм (кгс/мм)	F=Lx40%		F=Lx45%		F=Lx50%		Артикул Тип D-L
				Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	
Количество операций			1 000 000	500 000		300 000				
16	8	20	20,6 {2,10}	8,0	9,0	10,0	10,0	10,0	206 {21}	SW 16-20
		25	16,5 {1,68}	10,0	11,2	12,5	12,5	12,5	206 {21}	SW 16-25
		30	13,7 {1,40}	12,0	13,5	15,0	15,0	15,0	206 {21}	SW 16-30
		35	11,8 {1,20}	14,0	15,7	17,5	17,5	17,5	206 {21}	SW 16-35
		40	10,3 {1,05}	16,0	18,0	20,0	20,0	20,0	206 {21}	SW 16-40
		45	9,2 {0,93}	18,0	20,2	22,5	22,5	22,5	206 {21}	SW 16-45
		50	8,2 {0,84}	20,0	22,5	25,0	25,0	25,0	206 {21}	SW 16-50
		55	7,5 {0,76}	22,0	24,7	27,5	27,5	27,5	206 {21}	SW 16-55
		60	6,9 {0,70}	24,0	27,0	30,0	30,0	30,0	206 {21}	SW 16-60
		65	6,3 {0,65}	26,0	29,3	32,5	32,5	32,5	206 {21}	SW 16-65
		70	5,9 {0,60}	28,0	31,5	35,0	35,0	35,0	206 {21}	SW 16-70
		75	5,5 {0,56}	30,0	33,7	37,5	37,5	37,5	206 {21}	SW 16-75
		80	5,1 {0,53}	32,0	36,0	40,0	40,0	40,0	206 {21}	SW 16-80
18	9	20	25,5 {2,60}	8,0	9,0	10,0	10,0	10,0	255 {26}	SW 18-20
		25	20,4 {2,08}	10,0	11,2	12,5	12,5	12,5	255 {26}	SW 18-25
		30	17,0 {1,73}	12,0	13,5	15,0	15,0	15,0	255 {26}	SW 18-30
		35	14,6 {1,49}	14,0	15,7	17,5	17,5	17,5	255 {26}	SW 18-35
		40	12,7 {1,30}	16,0	18,0	20,0	20,0	20,0	255 {26}	SW 18-40
		45	11,3 {1,16}	18,0	20,2	22,5	22,5	22,5	255 {26}	SW 18-45
		50	10,2 {1,04}	20,0	22,5	25,0	25,0	25,0	255 {26}	SW 18-50
		55	9,3 {0,95}	22,0	24,7	27,5	27,5	27,5	255 {26}	SW 18-55
		60	8,5 {0,87}	24,0	27,0	30,0	30,0	30,0	255 {26}	SW 18-60
		65	7,8 {0,80}	26,0	29,2	32,5	32,5	32,5	255 {26}	SW 18-65
		70	7,3 {0,74}	28,0	31,5	35,0	35,0	35,0	255 {26}	SW 18-70
		75	6,8 {0,69}	30,0	33,7	37,5	37,5	37,5	255 {26}	SW 18-75
		80	6,4 {0,65}	32,0	36,0	40,0	40,0	40,0	255 {26}	SW 18-80
90	5,7 {0,58}	36,0	40,5	45,0	45,0	45,0	255 {26}	SW 18-90		
20	10	20	31,4 {3,20}	8,0	9,0	10,0	10,0	10,0	314 {32}	SW 20-20
		25	25,1 {2,56}	10,0	11,2	12,5	12,5	12,5	314 {32}	SW 20-25
		30	20,9 {2,13}	12,0	13,5	15,0	15,0	15,0	314 {32}	SW 20-30
		35	17,9 {1,83}	14,0	15,7	17,5	17,5	17,5	314 {32}	SW 20-35
		40	15,7 {1,60}	16,0	18,0	20,0	20,0	20,0	314 {32}	SW 20-40
		45	13,9 {1,42}	18,0	20,2	22,5	22,5	22,5	314 {32}	SW 20-45
		50	12,6 {1,28}	20,0	22,5	25,0	25,0	25,0	314 {32}	SW 20-50
		55	11,4 {1,16}	22,0	24,7	27,5	27,5	27,5	314 {32}	SW 20-55
		60	10,5 {1,07}	24,0	27,0	30,0	30,0	30,0	314 {32}	SW 20-60
		65	9,7 {0,98}	26,0	29,2	32,5	32,5	32,5	314 {32}	SW 20-65
		70	9,0 {0,91}	28,0	31,5	35,0	35,0	35,0	314 {32}	SW 20-70
		75	8,4 {0,85}	30,0	33,7	37,5	37,5	37,5	314 {32}	SW 20-75
		80	7,8 {0,80}	32,0	36,0	40,0	40,0	40,0	314 {32}	SW 20-80
90	7,0 {0,71}	36,0	40,5	45,0	45,0	45,0	314 {32}	SW 20-90		
22	11	25	31,4 {3,20}	10,0	11,2	12,5	12,5	12,5	392 {40}	SW 22-25
		30	26,2 {2,67}	12,0	13,5					

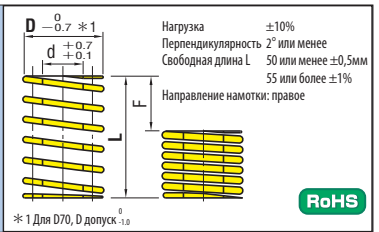

D	d	L	Жесткость пружины Н/мм (кгс/мм)	F=Lx40%		F=Lx45%		F=Lx50%		Артикул
				Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	
Количество операций				1 000 000	500 000	300 000	Тип D-L			
25	13,5	25	39,2 (4,00)	10,0	392 {40}	11,2	441 {45}	12,5	490 {21}	SW 25-25
		30	32,7 (3,33)	12,0		13,5		15,0		SW 25-30
		35	28,0 (2,86)	14,0		15,7		17,5		SW 25-35
		40	24,5 (2,50)	16,0		18,0		20,0		SW 25-40
		45	21,8 (2,22)	18,0		20,2		22,5		SW 25-45
		50	19,6 (2,00)	20,0		22,5		25,0		SW 25-50
		55	17,8 (1,82)	22,0		24,7		27,5		SW 25-55
		60	16,3 (1,67)	24,0		27,0		30,0		SW 25-60
		65	15,4 (1,54)	26,0		29,2		32,5		SW 25-65
		70	14,0 (1,43)	28,0		31,5		35,0		SW 25-70
		75	13,1 (1,33)	30,0		33,7		37,5		SW 25-75
		80	12,3 (1,25)	32,0		36,0		40,0		SW 25-80
		90	10,9 (1,11)	36,0		40,5		45,0		SW 25-90
		100	9,8 (1,00)	40,0		45,0		50,0		SW 25-100
		125	7,8 (0,80)	50,0		56,2		62,5		SW 25-125
		150	6,5 (0,67)	60,0		67,5		75,0		SW 25-150
175	5,6 (0,57)	70,0	78,7	87,5	SW 25-175					
200	4,9 (0,50)	80,0	90,0	100,0	SW 25-200					
27	13,5	25	47,1 (4,80)	10,0	471 {48}	11,2	530 {54}	12,5	588 {60}	SW 27-25
		30	39,2 (4,00)	12,0		13,5		15,0		SW 27-30
		35	33,6 (3,43)	14,0		15,7		17,5		SW 27-35
		40	29,4 (3,00)	16,0		18,0		20,0		SW 27-40
		45	26,2 (2,67)	18,0		20,2		22,5		SW 27-45
		50	23,5 (2,40)	20,0		22,5		25,0		SW 27-50
		55	21,4 (2,18)	22,0		24,7		27,5		SW 27-55
		60	19,6 (2,00)	24,0		27,0		30,0		SW 27-60
		65	18,1 (1,85)	26,0		29,2		32,5		SW 27-65
		70	16,8 (1,71)	28,0		31,5		35,0		SW 27-70
		75	15,7 (1,60)	30,0		33,7		37,5		SW 27-75
		80	14,7 (1,50)	32,0		36,0		40,0		SW 27-80
		90	13,1 (1,33)	36,0		40,5		45,0		SW 27-90
		100	11,8 (1,20)	40,0		45,0		50,0		SW 27-100
		125	9,4 (0,96)	50,0		56,2		62,5		SW 27-125
		150	7,8 (0,80)	60,0		67,5		75,0		SW 27-150
175	6,7 (0,69)	70,0	78,7	87,5	SW 27-175					
200	5,9 (0,60)	80,0	90,0	100,0	SW 27-200					
30	16	25	56,5 (5,76)	10,0	565 {58}	11,2	635 {65}	12,5	706 {32}	SW 30-25
		30	47,1 (4,80)	12,0		13,5		15,0		SW 30-30
		35	40,3 (4,11)	14,0		15,7		17,5		SW 30-35
		40	35,3 (3,60)	16,0		18,0		20,0		SW 30-40
		45	31,4 (3,20)	18,0		20,2		22,5		SW 30-45
		50	28,2 (2,88)	20,0		22,5		25,0		SW 30-50
		55	25,7 (2,62)	22,0		24,7		27,5		SW 30-55
		60	23,5 (2,40)	24,0		27,0		30,0		SW 30-60
		65	21,7 (2,22)	26,0		29,2		32,5		SW 30-65
		70	20,2 (2,06)	28,0		31,5		35,0		SW 30-70
		75	18,8 (1,92)	30,0		33,7		37,5		SW 30-75
		80	17,7 (1,80)	32,0		36,0		40,0		SW 30-80
		90	15,7 (1,60)	36,0		40,5		45,0		SW 30-90
		100	14,1 (1,44)	40,0		45,0		50,0		SW 30-100
		125	11,3 (1,15)	50,0		56,2		62,5		SW 30-125
		150	9,4 (0,96)	60,0		67,5		75,0		SW 30-150
175	8,1 (0,82)	70,0	78,7	87,5	SW 30-175					
200	7,1 (0,72)	80,0	90,0	100,0	SW 30-200					
35	19	40	48,0 (4,89)	16,0	768 {78}	18,0	864 {88}	20,0	960 {98}	SW 35-40
		45	42,7 (4,35)	18,0		20,2		22,5		SW 35-45
		50	38,4 (3,92)	20,0		22,5		25,0		SW 35-50
		55	34,9 (3,56)	22,0		24,7		27,5		SW 35-55
		60	32,0 (3,26)	24,0		27,0		30,0		SW 35-60
		65	29,5 (3,01)	26,0		29,2		32,5		SW 35-65
		70	27,4 (2,80)	28,0		31,5		35,0		SW 35-70
		75	25,6 (2,61)	30,0		33,7		37,5		SW 35-75
		80	24,0 (2,45)	32,0		36,0		40,0		SW 35-80
		90	21,3 (2,18)	36,0		40,5		45,0		SW 35-90
		100	19,2 (1,96)	40,0		45,0		50,0		SW 35-100
		125	15,4 (1,57)	50,0		56,2		62,5		SW 35-125
		150	12,8 (1,31)	60,0		67,5		75,0		SW 35-150
		175	11,0 (1,12)	70,0		78,7		87,5		SW 35-175
		200	9,6 (0,98)	80,0		90,0		100,0		SW 35-200



D	d	L	Жесткость пружины Н/мм (кгс/мм)	F=Lx40%		F=Lx45%		F=Lx50%		Артикул
				Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	Fмм	Нагр. Н (кгс)	
Количество операций				1 000 000	500 000	300 000	Тип D-L			
40	22	40	62,7 (6,39)	16,0	1003 {102}	18,0	1129 {115}	20,0	1254 {128}	SW 40-40
		45	55,7 (5,68)	18,0		20,2		22,5		SW 40-45
		50	50,2 (5,11)	20,0		22,5		25,0		SW 40-50
		55	45,6 (4,65)	22,0		24,7		27,5		SW 40-55
		60	41,8 (4,26)	24,0		27,0		30,0		SW 40-60
		65	38,6 (3,93)	26,0		29,2		32,5		SW 40-65
		70	35,8 (3,65)	28,0		31,5		35,0		SW 40-70
		75	33,4 (3,41)	30,0		33,7		37,5		SW 40-75
		80	31,4 (3,20)	32,0		36,0		40,0		SW 40-80
		90	27,9 (2,84)	36,0		40,5		45,0		SW 40-90
		100	25,1 (2,56)	40,0		45,0		50,0		SW 40-100
		125	20,1 (2,05)	50,0		56,2		62,5		SW 40-125
		150	16,7 (1,70)	60,0		67,5		75,0		SW 40-150
		175	14,3 (1,46)	70,0		78,7		87,5		SW 40-175
		200	12,5 (1,28)	80,0		90,0		100,0		SW 40-200
		225	11,1 (1,14)	90,0		101,3		112,5		SW 40-225
250	10,4 (1,02)	100,0	112,5	125,0	SW 40-250					
275	9,1 (0,93)	110,0	123,8	137,5	SW 40-275					
300	8,4 (0,85)	120,0	135,0	150,0	SW 40-300					
50	27,5	50	78,4 (7,99)	20,0	1568 {160}	22,5	1764 {180}	25,0	1960 {200}	SW 50-50
		55	71,3 (7,27)	22,0		24,7		27,5		SW 50-55
		60	65,3 (6,66)	24,0		27,0		30,0		SW 50-60
		65	60,3 (6,15)	26,0		29,2		32,5		SW 50-65
		70	56,0 (5,71)	28,0		31,5		35,0		SW 50-70
		75	52,3 (5,33)	30,0		33,7		37,5		SW 50-75
		80	49,0 (5,00)	32,0		36,0		40,0		SW 50-80
		90	43,6 (4,44)	36,0		40,5		45,0		SW 50-90
		100	39,2 (4,00)	40,0		45,0		50,0		SW 50-100
		125	31,4 (3,20)	50,0		56,2		62,5		SW 50-125
		150	26,1 (2,66)	60,0		67,5		75,0		SW 50-150
		175	22,4 (2,28)	70,0		78,7		87,5		SW 50-175
		200	19,6 (2,00)	80,0		90,0		100,0		SW 50-200
		225	17,4 (1,78)	90,0		101,3		112,5		SW 50-225
		250	15,7 (1,60)	100,0		112,5		125,0		SW 50-250
		275	14,3 (1,45)	110,0		123,8		137,5		SW 50-275
300	13,1 (1,33)	120,0	135,0	150,0	SW 50-300					
350	11,2 (1,14)	140,0	157,5	175,0	SW 50-350					
400	9,8 (1,00)	160,0	180,0	200,0	SW 50-400					
450	8,7 (0,89)	180,0	202,5	225,0	SW 50-450					
500	7,8 (0,80)	200,0	225,0	250,0	SW 50-500					
60	33	60	94,0 (9,59)	24,0	2256 {230}	27,0	2538 {259}	30,0	2820 {288}	SW 60-60
		70	80,6 (8,22)	28,0		31,5		35,0		SW 60-70
		80	70,5 (7,19)	32,0		36,0		40,0		SW 60-80
		90	62,7 (6,39)	36,0		40,5		45,0		SW 60-90
		100	56,4 (5,75)	40,0		45,0		50,0		SW 60-100
		125	45,1 (4,60)	50,0		56,2		62,5		SW 60-125
		150	37,6 (3,83)	60,0		67,5		75,0		SW 60-150
		175	32,2 (3,29)	70,0		78,7		87,5		SW 60-175
		200	28,2 (2,88)	80,0		90,0		100,0		SW 60-200
		225	25,1 (2,56)	90,0		101,3		112,5		SW 60-225
		250	22,6 (2,30)	100,0		112,5		125,0		SW 60-250
		275	20,5 (2,09)	110,0		123,8		137,5		SW 60-275
		300	18,8 (1,92)	120,0		135,0		150,0		SW 60-300
		350	16,1 (1,64)	140,0		157,0		175,0		SW 60-350
		400	14,4 (1,44)	160,0		180,0		200,0		SW 60-400
		450	12,5 (1,28)	180,0		202,5		225,0		SW 60-450
500	11,3 (1,15)	200,0	225,0	250,0	SW 60-500					
70	38,5	70	11,2 (1,14)	28,0	3136 {320}	31,5	3528 {360}	35,0	3920 {400}	SW 70-70
		80	98,0 (9,99)	32,0		36,0		40,0		SW 70-80
		90	87,1 (8,88)	36,0		40,5		45,0		SW 70-90
		100	78,4 (7,99)	40,0		45,0		50,0		SW 70-100
		125	62,7 (6,40)	50,0		56,2		62,5		SW 70-125
		150	52,3 (5,33)	60,0		67,5		75,0		SW 70-150
		175	44,8 (4,57)	70,0		78,7		87,5		SW 70-175
		200	39,2 (4,00)	80,0		90,0		100,0		SW 70-200
		250	31,4 (3,20)	100,0		112,5		125,0		SW 70-250
		300	26,1 (2,66)	120,0		135,0		150,0		SW 70-300
		350	22,4 (2,28)	140,0		157,0		175,0		SW 70-350