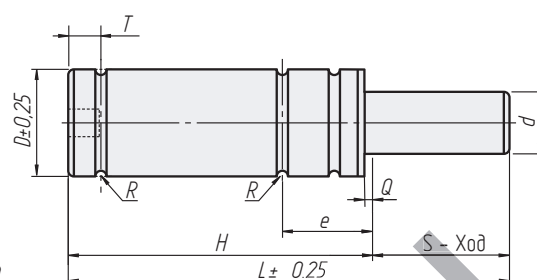
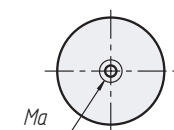
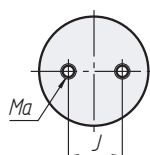
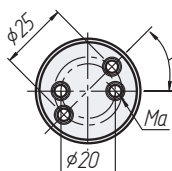
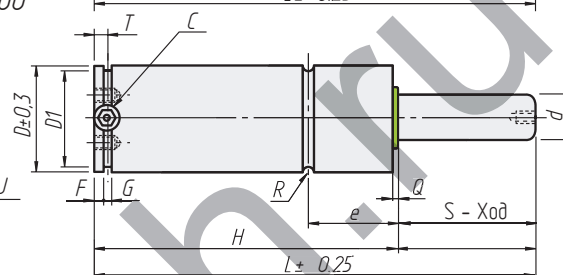
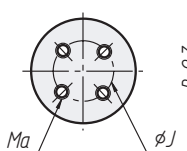


Газовые пружины MISUMI
GSV


Давление азота	МПа (кгс/см ²)
GSV 170 — 350	18 (183.5)
GSV 500 — 200	15 (153)

GSV 170, 320

*GSV 350
GSV 750 — 1500*

GSV 500

GSV 2400 — 12000

 Пример заказа (артикул): **GSV 170-7**

Артикул	S	D	D ₁	d	L	H	e	R	T	F	G	Ma	J	Q	C	Усилие пружины, Н (кгс)		Вес, кг
																Номин.	Макс.	
GSV 170-7	7	19	17	11	44	37	17	1	6	-	-	1-M6×6	-	1	M6	1700 {173}	2800 {286}	0,06
GSV 170-10	10				50	40											2800 {286}	0,06
GSV 170-15	15				60	45											2800 {286}	0,07
GSV 170-19	19				68	49											2800 {286}	0,07
GSV 170-25	25				80	55											2800 {286}	0,08
GSV 170-38	38				106	68											2800 {286}	0,09
GSV 170-50	50				130	80											2800 {286}	0,11
GSV 170-63	63				156	93											2800 {286}	0,12
GSV 170-75	75				185	110											2800 {286}	0,14
GSV 170-80	80				195	115											2800 {286}	0,15
GSV 170-100	100	25	23	15	235	135	17	1	6	-	-	1-M6×6	-	1	M6	3200 {326}	2800 {286}	0,17
GSV 170-125	125				285	160											2800 {286}	0,19
GSV 320-7	7				44	37											4800 {488}	0,10
GSV 320-10	10				50	40											4900 {500}	0,10
GSV 320-15	15				60	45											5100 {520}	0,11
GSV 320-19	19				68	49											5100 {520}	0,12
GSV 320-25	25				80	55											5200 {530}	0,13
GSV 320-38	38				106	68											5300 {540}	0,15
GSV 320-50	50				130	80											5300 {540}	0,17
GSV 320-63	63				156	93											5300 {540}	0,19
GSV 320-75	75	32	27	16	185	110	12,5	1,05	6	4	3,5	2-M6×6	20	1	M6	3600 {367}	5300 {540}	0,22
GSV 320-80	80				195	115											5300 {540}	0,23
GSV 320-100	100				235	135											5300 {540}	0,26
GSV 320-125	125				285	160											5300 {540}	0,30
GSV 350-10	10				50	40											5900 {602}	0,16
GSV 350-13	13				56	43											5200 {530}	0,17
GSV 350-16	16				62	46											5300 {540}	0,18
GSV 350-19	19				68	49											5600 {571}	0,19
GSV 350-25	25				80	55											5500 {561}	0,21
GSV 350-32	32				94	62											5500 {561}	0,23
GSV 350-38	38	32	27	16	106	68	12,5	1,05	6	4	3,5	2-M6×6	20	1	M6	3600 {367}	5500 {561}	0,25
GSV 350-50	50				130	80											5500 {561}	0,29
GSV 350-63	63				156	93											5500 {561}	0,33
GSV 350-75	75				180	105											5500 {561}	0,36
GSV 350-80	80				190	110											5500 {561}	0,38
GSV 350-100	100				230	130											5500 {561}	0,44
GSV 350-125	125				280	155											5500 {561}	0,51

Газовые пружины MISUMI

GSV

Артикул	S	D	D ₁	d	L	H	e	R	T	F	G	Ma	J	Q	C	Усилие пружины, Н (кгс)		Вес, кг
																Номин.	Макс.	
GSV 500-10	10	38	33	20	50	40	12,5	1,05	6	4	3,5	2-M6×6 (Ø20) или 2-M6×6 (Ø25)	-	2	M6	4700 {479}	7200{734}	0.24
GSV 500-13	13				56	43											7100{724}	0.25
GSV 500-16	16				62	46											7200{734}	0.26
GSV 500-19	19				68	49											7400{755}	0.28
GSV 500-25	25				80	55											7300{744}	0.31
GSV 500-32	32				94	62											7200{734}	0.34
GSV 500-38	38				106	68											7200{734}	0.37
GSV 500-50	50				130	80											7200{734}	0.42
GSV 500-63	63				156	93											7200{734}	0.48
GSV 500-75	75				180	105											7100{724}	0.54
GSV 500-80	80				190	110											7100{724}	0.56
GSV 500-100	100				230	130											7100{724}	0.66
GSV 500-125	125				280	155											7100{724}	0.77
GSV 750-10	10	45	40	25	52	42	16,5	1,05	6	4	3,5	2-M8×6	20	2	M6	7400 {755}	12100{1234}	0.36
GSV 750-13	13				58	45											12100{1234}	0.38
GSV 750-16	16				64	48											12100{1234}	0.39
GSV 750-19	19				70	51											11700{1193}	0.41
GSV 750-25	25				82	57											11800{1203}	0.45
GSV 750-32	32				96	64											11800{1203}	0.50
GSV 750-38	38				108	70											11800{1203}	0.54
GSV 750-50	50				132	82											11800{1203}	0.61
GSV 750-63	63				158	95											11800{1203}	0.70
GSV 750-75	75				182	107											11900{1213}	0.77
GSV 750-80	80				192	112											11900{1213}	0.81
GSV 750-100	100				232	132											11900{1213}	0.93
GSV 750-125	125				282	157											11900{1213}	1.10
GSV 1000-10	10	50	43	28	58	48	17,5	2,05	6	8	5	2-M8×6	20	3	M6	9200 {938}	13800 {1407}	0.49
GSV 1000-13	13				64	51											13800 {1407}	0.51
GSV 1000-16	16				70	54											13800 {1407}	0.54
GSV 1000-19	19				76	57											14000 {1428}	0.56
GSV 1000-25	25				88	63											14200 {1448}	0.61
GSV 1000-32	32				102	70											14300 {1458}	0.67
GSV 1000-38	38				114	76											14500 {1479}	0.71
GSV 1000-50	50				138	88											14600 {1489}	0.81
GSV 1000-63	63				164	101											14700 {1499}	0.91
GSV 1000-75	75				188	113											14700 {1499}	1.05
GSV 1000-80	80				198	118											14800 {1509}	1.09
GSV 1000-100	100				238	138											14800 {1509}	1.21
GSV 1000-125	125				288	163											14800 {1509}	1.41
GSV 1500-13	13	63	56	38	70	57	19	2,05	6	8	5	2-M8×6	20	3	M6	15000 {1530}	24000 {2447}	0.92
GSV 1500-16	16				76	60											24100 {2458}	0.96
GSV 1500-19	19				82	63											24200 {2468}	0.99
GSV 1500-25	25				94	69											24300 {2478}	1.06
GSV 1500-32	32				108	76											23800 {2427}	1.14
GSV 1500-38	38				120	82											23900 {2437}	1.21
GSV 1500-50	50				144	94											24000 {2447}	1.35
GSV 1500-63	63				170	107											24100 {2458}	1.51
GSV 1500-75	75				194	119											24200 {2468}	1.65
GSV 1500-80	80				204	124											24200 {2468}	1.71
GSV 1500-100	100				244	144											24300 {2478}	1.94
GSV 1500-125	125				294	169											24300 {2478}	2.23
GSV 2400-16	16	75	67	45	77	61	21	2,55	6	8	5	4-M8×13	40	3	M6	24000 {2447}	38300 {3906}	1.36
GSV 2400-19	19				83	64											38500 {3926}	1.40
GSV 2400-25	25				95	70											38700 {3946}	1.50
GSV 2400-32	32				109	77											38600 {3936}	1.61
GSV 2400-38	38				121	83											38400 {3916}	1.70
GSV 2400-50	50				145	95											39200 {3997}	1.89
GSV 2400-63	63				171	108											39200 {3997}	2.09
GSV 2400-75	75				195	120											39200 {3997}	2.28
GSV 2400-80	80				205	125											39200 {3997}	2.36
GSV 2400-100	100				245	145											39300 {4007}	2.67
GSV 2400-125	125				295	170											39300 {4007}	3.07

Газовые пружины MISUMI
GSV

Артикул	S	D	D ₁	d	L	H	e	R	T	F	G	Ma	J	Q	C	Усилие пружины, Н (кгс)		Вес, кг
																Номин.	Макс.	
GSV 4200-16	16	95	87	60	90	74	24	2,55	10,5	8	5	4-M8×13	60	3	G1/8	42000 {4283}	61700 {6292}	2.76
GSV 4200-19	19				96	77											63700 {6496}	2.83
GSV 4200-25	25				108	83											60800 {6200}	2.98
GSV 4200-32	32				122	90											64300 {6557}	3.16
GSV 4200-38	38				134	96											65800 {6710}	3.30
GSV 4200-50	50				158	108											67000 {6832}	3.60
GSV 4200-63	63				184	121											67800 {6914}	3.93
GSV 4200-75	75				208	133											68000 {6934}	4.20
GSV 4200-80	80				218	138											68600 {6995}	4.35
GSV 4200-100	100				258	158											69100 {7046}	4.85
GSV 4200-125	125				308	183											69600 {7097}	5.47
GSV 6600-16	16	120	112	74	100	84	25,5	2,55	10,5	8	5	4-M10×13	80	3	G1/8	66000 {6730}	89000 {9075}	5.06
GSV 6600-19	19				106	87											91000 {9279}	5.17
GSV 6600-25	25				118	93											93900 {9575}	5.42
GSV 6600-32	32				132	100											96100 {9799}	5.69
GSV 6600-38	38				144	106											98200 {10014}	5.93
GSV 6600-50	50				168	118											100600 {10258}	6.40
GSV 6600-63	63				194	131											102400 {10442}	6.90
GSV 6600-75	75				218	143											103400 {10544}	7.40
GSV 6600-80	80				228	148											104100 {10615}	7.60
GSV 6600-100	100				268	168											105400 {10748}	8.40
GSV 6600-125	125				318	193											106500 {10860}	9.40
GSV 9500-19	19	150	142	90	116	97	27,5	2,55	10,5	8	5	4-M10×13	100	3	G1/8	95400 {9728}	135000 {13766}	9.51
GSV 9500-25	25				128	103											139000 {14174}	9.90
GSV 9500-32	32				142	110											142000 {14480}	10.30
GSV 9500-38	38				154	116											143000 {14582}	10.70
GSV 9500-50	50				178	128											146000 {14888}	11.40
GSV 9500-63	63				204	141											148000 {15092}	12.20
GSV 9500-75	75				228	153											149000 {15194}	13.00
GSV 9500-80	80				238	158											150000 {15296}	13.30
GSV 9500-100	100				278	178											151000 {15398}	14.60
GSV 9500-125	125				328	203											152000 {15500}	16.10
GSV 12000-19	19	150	142	100	116	97	27,5	2,55	10,5	8	5	4-M10×13	100	3	G1/8	117800 {12012}	159500 {16261}	9.57
GSV 12000-25	25				128	103											166100 {16942}	9.96
GSV 12000-32	32				142	110											172200 {17555}	10.41
GSV 12000-38	38				154	116											176300 {17975}	10.81
GSV 12000-50	50				178	128											182500 {18614}	11.59
GSV 12000-63	63				204	141											187400 {19111}	11.88
GSV 12000-75	75				228	153											190800 {19455}	12.21
GSV 12000-80	80				238	158											192000 {19575}	12.43
GSV 12000-100	100				278	178											195800 {19962}	13.51
GSV 12000-125	125				328	203											199100 {20301}	15.14
GSV 20000-19	19	195	187	130	148	129	33,5	2,55	15	8	8	4-M12×16	120	3	G1/8	117000 {11930}	259000 {26410}	21.60
GSV 20000-25	25				160	135											270000 {27532}	22.30
GSV 20000-32	32				174	142											280000 {28552}	23.10
GSV 20000-38	38				186	148											287000 {29265}	23.90
GSV 20000-50	50				210	160											298000 {30387}	25.30
GSV 20000-63	63				236	173											307000 {31305}	26.80
GSV 20000-75	75				260	185											313000 {31917}	28.40
GSV 20000-80	80				270	190											315000 {32121}	28.80
GSV 20000-100	100				310	210											323000 {32936}	31.20
GSV 20000-125	125				360	235											330000 {33650}	34.20